APPLICA	BLE STAND	ARD									
	OPERATING TEMPERATURE RANGE RATING VOLTAGE		−55°C TO +85°C	STORAGE TEMPERAT	ORAGE MPERATURE RANGE		-10°C TO +50°C(PACKED CONDITION)				
RATING			30V AC/DC	OPERATING OR STORAG HUMIDITY RANGE		ORAGE	RELATIVE HUMIDITY 90%MAX(NOT DEWE))	
CURRENT		0.2A	APPLICABLE CABLE			t=0.2±0.03mm, GOLD PLATING					
			SPE	CIFICA	ATIONS	S					
Ι	TEM		TEST METHOD)			REQL	JIREMENTS	QT	AT	
CONSTR	UCTION										
GENERAL E	XAMINATION	VISUALL	Y AND BY MEASURING IN	STRUMENT	. A	ACCORDING TO DRAWING.				×	
MARKING		CONFIRM	MED VISUALLY.						×	×	
ELECTRI	C CHARAC	TERIST	ICS						•		
VOLTAGE P	ROOF	90V AC F	FOR 1 min.		N	O FLAS	SHOVER OR	BREAKDOWN.	×	×	
INSULATION	N RESISTANCE	100V DC			50	0MΩ M	IN.		T _×	 ×	
CONTACT F	RESISTANCE	AC 20mV	MAX (1KHz), 1mA.		11	00m Ω	MAX.		×	×	
					IN	NCLUDI	NG FPC BUL	K RESISTANCE (L=12mm		^	
MECHAN	ICAL CHAF	RACTER	ISTICS								
VIBRATION		_	NCY 10 TO 55 Hz, HALF A	MPLITUDE	[1) NO E	LECTRICAL	DISCONTINUITY OF 1 μ s	i.	Т	
OLIC ST			FOR 10 CYCLES IN 3 AXIA			② CONTACT RESISTANCE: 100mΩ MAX.			×	\perp	
SHOCK			981 m/s ² , DURATION OF PULSE 6ms AT 3 TIMES IN 3 BOTH AXIAL DIRECTIONS.				AMAGE, CRA ARTS.	ACK AND LOOSENESS	×	-	
MECHANICA			ES INSERTIONS AND EXTRACTIONS.		1 2	① CONTACT RESISTANCE: 100mΩ MAX. ② NO DAMAGE, CRACK AND LOOSENESS			×	<u> </u>	
FPC RETEN	TION FORCE	MEASURED BY APPLICABLE FPC.			D	OF PARTS. DIRECTION OF INSERTION: 0.15 N×n MIN.				+	
(THICKN			HICKNESS OF FPC SHALL BE t=0.20mm T INITIAL CONDITION.)		(r	(note 1)			×	_	
ENVIRON	IMENTAL C	CHARAC	TERISTICS								
			EXPOSED AT 35±2°C, 5% SALT WATER SPRAY FOR 96h.		2	 CONTACT RESISTANCE: 100m Ω MAX. NO DAMAGE, CRACK AND LOOSENESS OF PARTS. NO EVIDENCE OF CORROSION WHICH AFFECTS TO OPERATION OF CONNECTOR. 			×	-	
RAPID CHANGE OF TEMPE		TEMPER	MPERATURE -55→+15 TO +35→+85→+15 TO +35 °C					FANCE: $100 \text{ m} \Omega$ MAX.	rR.		
TEMPERATURE		TIME $30 \rightarrow 2 \sim 3 \rightarrow 30 \rightarrow 2 \sim 3 \text{ min}$ UNDER 5 CYCLES.				 INSULATION RESISTANCE: 50MΩ MIN. NO DAMAGE, CRACK AND LOOSENESS 			×	-	
DAMP HEAT	-	EXPOSED AT 40±2°C,				OF PARTS.					
(STEADY ST	ATE)	RELATIV	RELATIVE HUMIDITY 90 TO 95%, 96h.						×		
COUN	IT I	DESCRIPT	ON OF REVISIONS	F REVISIONS DES		IGNED CHEC		CHECKED	DA	ATE	
<u> </u>						1		-			
REMARK							APPROVED	NM.NISHIMATSU		11.29	
						-	CHECKED	NM.NISHIMATSU		11.29	
Unless otherwise specified, refe			er to JIS C 5402			 	DESIGNED DRAWN	TY.MOGI TY.MOGI		11.29 11.29	
Note QT:Qualification Test AT:Assurance Test X:Applicable Test				DR	DRAWING NO. ELC4-157791						
HS			IFICATION SHEET PAR					26W-51S-0.3SHW			
117			LECTRIC CO., LTD.	_	CODE N	NO	CI 52	CL580-2415-6-05			
L	'		CC			vU.	<u></u>	J 241J-0-05	<u> </u>	1/2	

SPECIFICATIONS								
ITEM	TEST METHOD	REQUIREMENTS	QT	АТ				
DAMP HEAT, CYCLIC	EXPOSED AT -10 TO +65 °C RELATIVE HUMIDITY 90 TO 96 % 10 CYCLES, TOTAL 240h.	 CONTACT RESISTANCE: 100mΩ MAX. INSULATION RESISTANCE: 1MΩ MIN. (AT HIGH HUMIDITY) INSULATION RESISTANCE: 50MΩ MIN. (AT DRY) NO DAMAGE, CRACK AND LOOSENESS OF PARTS. 	×	_				
DRY HEAT	EXPOSED AT 85±2°C, 96h.	① CONTACT RESISTANCE: 100m Ω MAX. ② NO DAMAGE, CRACK AND LOOSENESS OF PARTS.		_				
COLD	EXPOSED AT -55±3°C, 96h.			_				
SULPHUR DIOXIDE [JIS C 0090]	EXPOSED AT 40±2°C, RELATIVE HUMIDITY 80±5 %, 25±5 PPM FOR 96h.	CONTACT RESISTANCE: 100mΩ MAX. NO DAMAGE, CRACK AND LOOSENESS OF PARTS.	×	_				
HYDROGEN SULPHIDE [JIS C 0092]	EXPOSED AT 40±2°C, RELATIVE HUMIDITY 80±5 %, 10 ~ 15 PPM FOR 96h.	③ NO EVIDENCE OF CORROSION WHICH AFFECTS TO OPERATION OF CONNECTOR.	×	_				
SOLDERABILITY	SOLDERED AT SOLDER TEMPERATURE, 235±5°C FOR IMMERSION DURATION, 2±0.5 sec.	A NEW UNIFORM COATING OF SOLDER SHALL COVER A MINIMUM OF 95 % OF THE SURFACE BEING IMMERSED.	×	_				
RESISTANCE TO SOLDERING HEAT	1) REFLOW SOLDERING: PEAK TMP. 250°CMAX. REFLOW TMP. 230°C MIN FOR 60 sec. 2) SOLDERING IRONS: TMP. 350±10°C FOR 5±1 sec.	NO DEFORMATION OF CASE OF EXCESSIVE LOOSENESS OF THE TERMINALS. (note 2)	×	-				


(note 1)


THIS PRODUCT HAS FLIP-LOCK CONSTRUCTION. FASTEN FPC ON PCB OR SOMETHING FIXED IF FORCE IN VERTICAL DIRECTION SHALL BE PREDICTED.


(note 2)

BLISTERS WHICH MAY OCCUR IN HOUSING DO NOT AFFECT PRODUCT PERFORMANCE.

Note QT	Qualification Test AT:Assurance Test X:Applicable Test	DRAWING NO.		ELC4-157791-06		;
R	SPECIFICATION SHEET	PART NO.	FH26W-51S-0.3SHW(05)			
4 5 ~	HIROSE ELECTRIC CO., LTD.	CODE NO	CL580)-2415-6-05	<u></u>	2/2

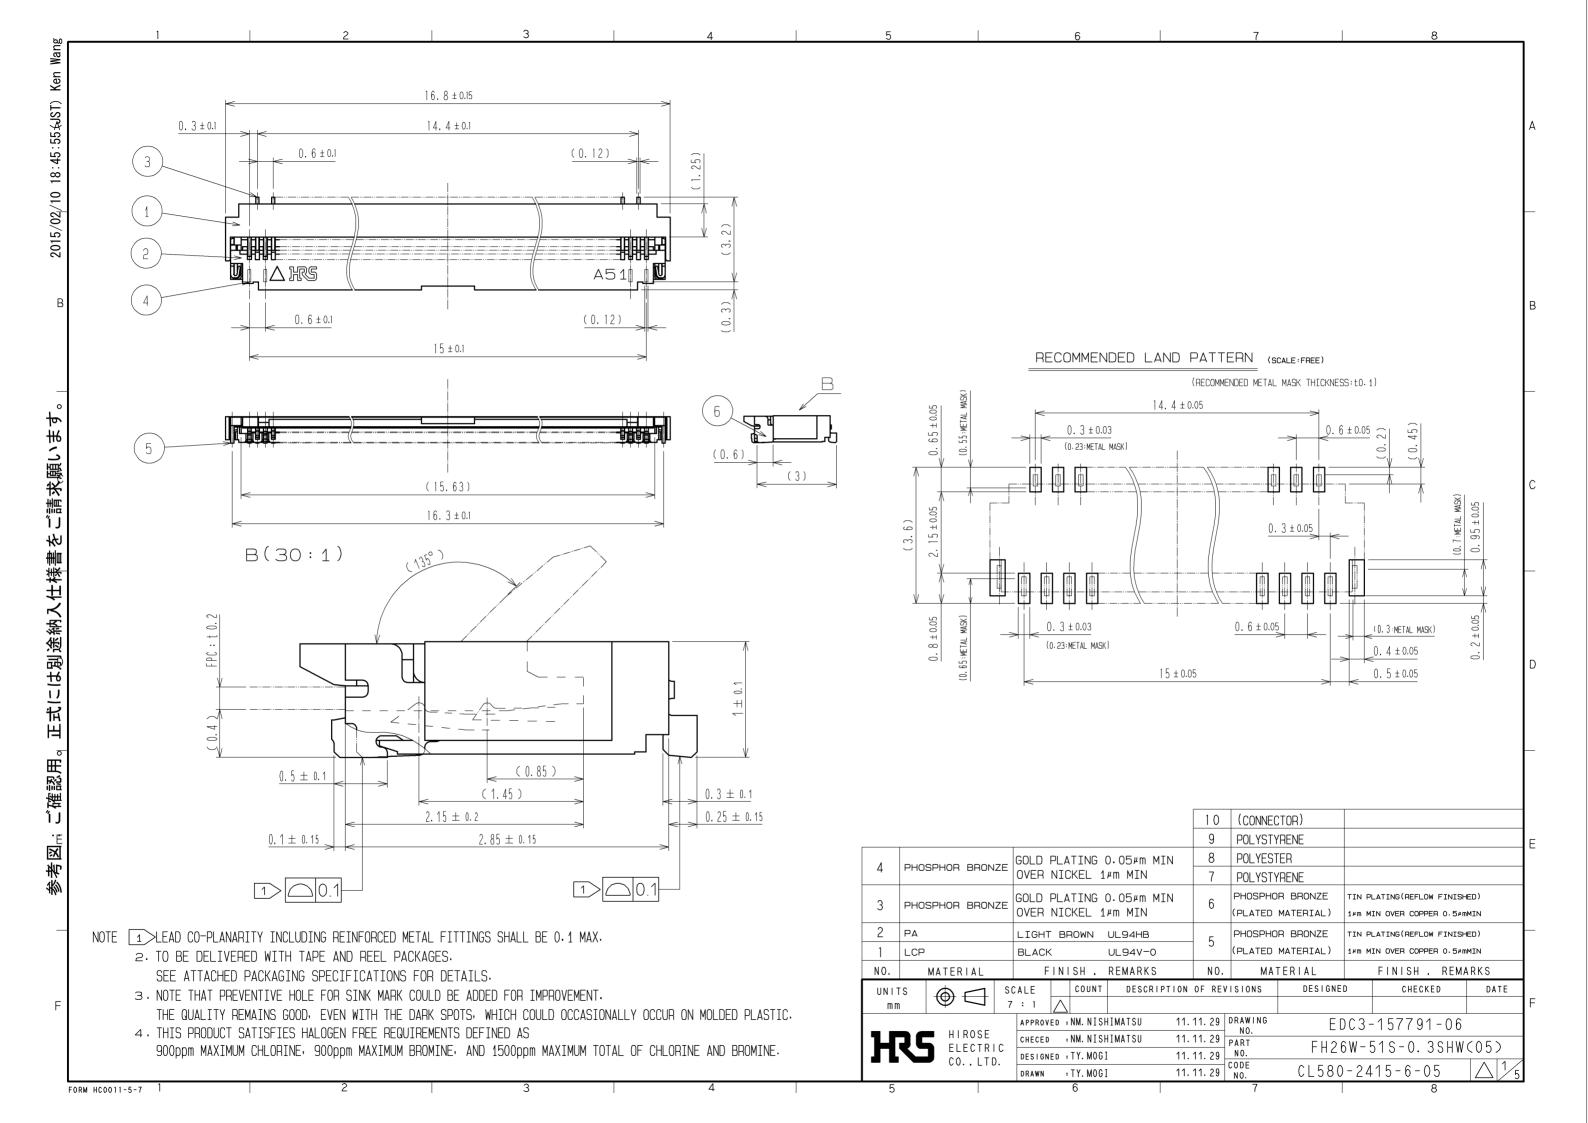

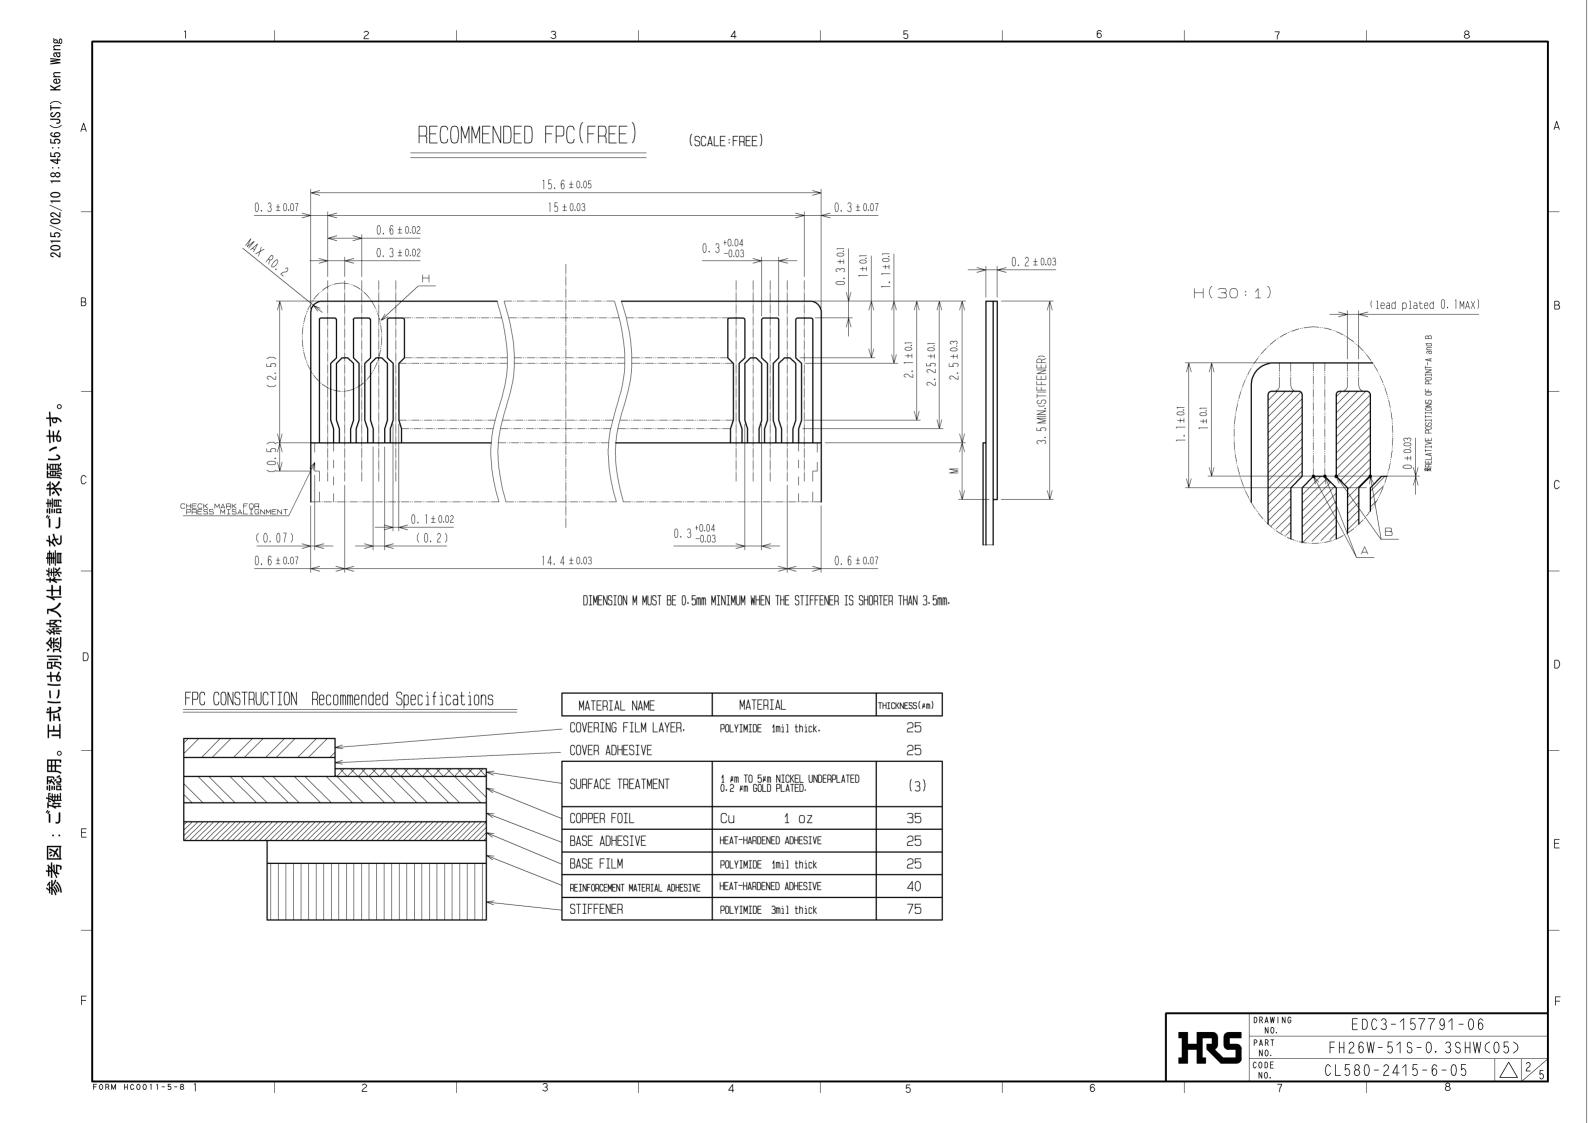

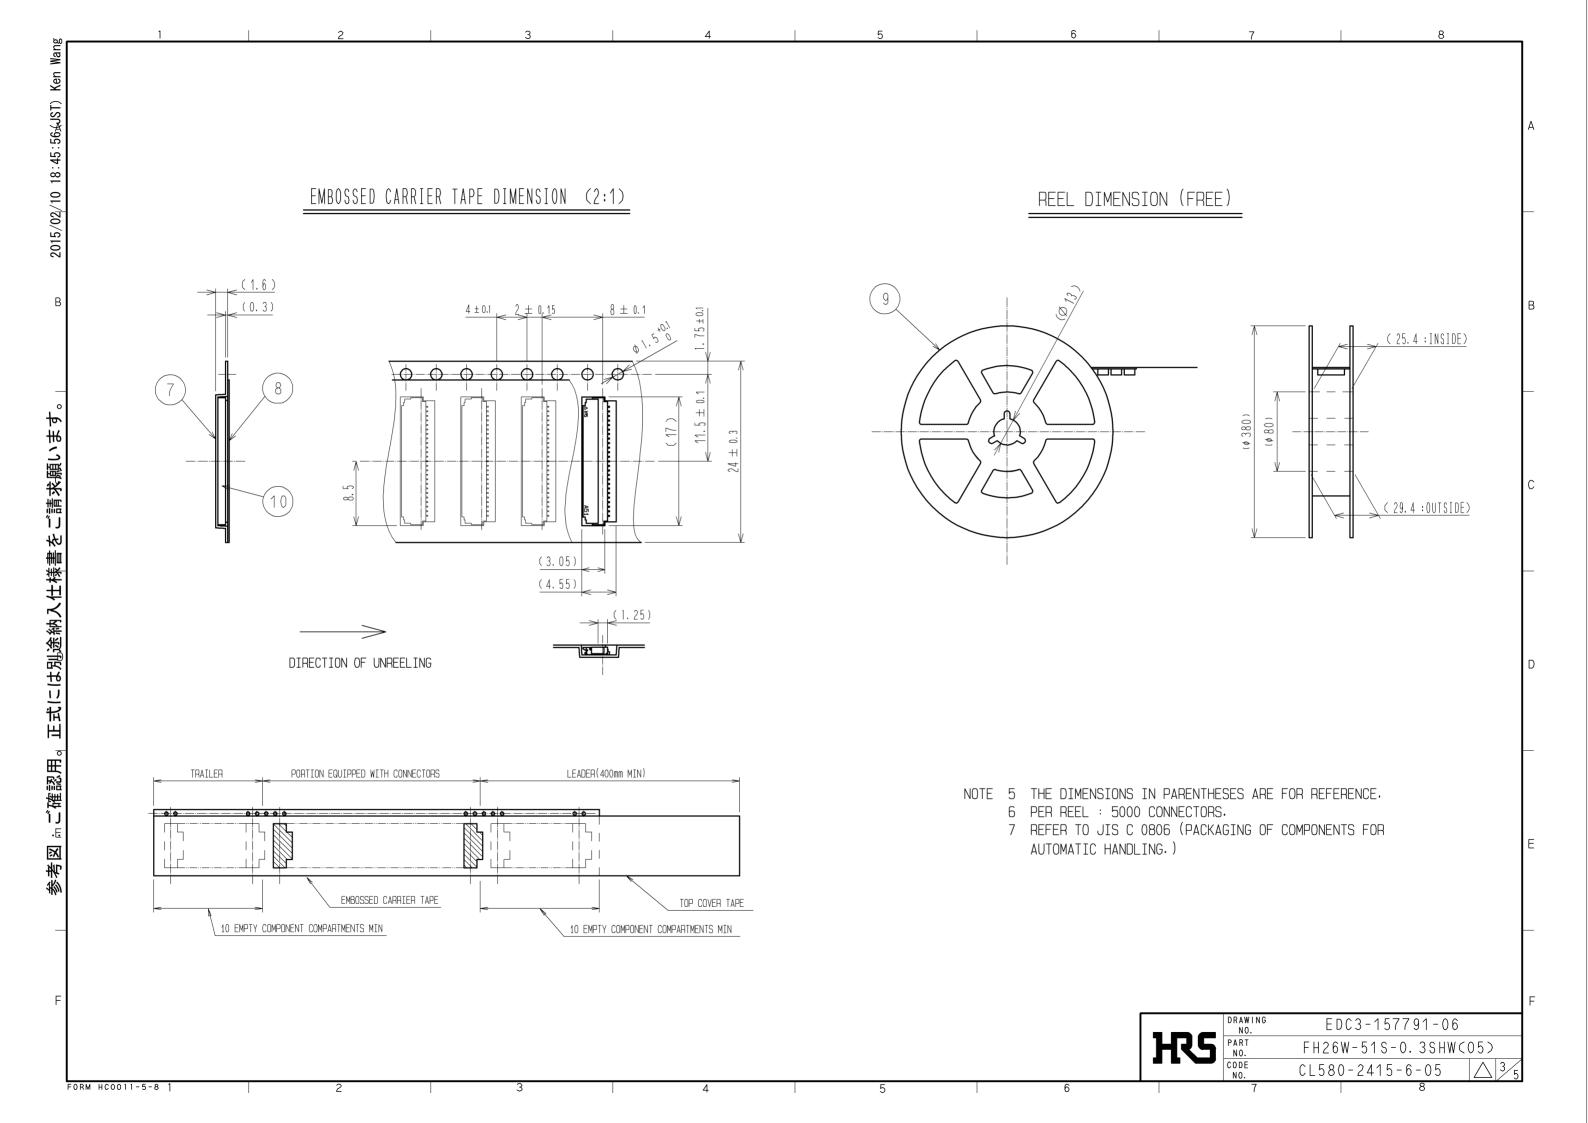

В

が図

This connector is small and thin and requires delicate and careful handling. Read through the instructions shown below and handle the connector properly. Each values indicating here are for reference and may differ from standard value.

[INSTRUCTIONS FOR MOUNTING ON THE BOARD]

♦Warp of Board

Minimize warp of the board as much as possible.

Lead co-planarity including reinforced metal fittings is 0.1 mm or less.

Too much warp of the board may result in a soldering failure.

♦Load to Connector

Do not apply a force of 0.5 N or more to the connector before mounting it on the board.

Otherwise, the connector may be broken.

Do not insert the FPC or operate the connector before mounting it.

♦Load to Board

·Splitting a large board into several pieces


·Screwing the board


Avoid the handling described above so that no force is exerted on the board during the assembly process. Otherwise, the connector may become defective.

♦Amount of Warp

The warp of a 100-mm wide board should be 0.5 mm or less.

The warp of board suffers stress on connector and the connector may become defective.

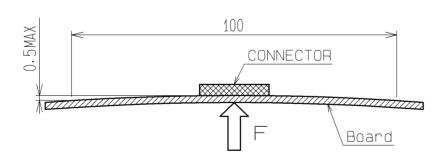

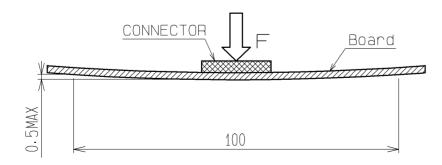


LINSTRUCTIONS ON INSERTING EPC AND CONNECTION!


♦ Use of the actuator

1. Be very careful not to apply excessive force when releasing the actuator in the initial position (with no FPC inserted).


If you use your nail or finger as shown below, the terminals may be deformed.

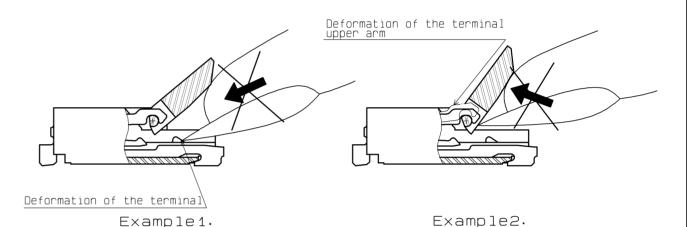

2. The actuator rotates around the rotational axis as shown below. Rotate the actuator.

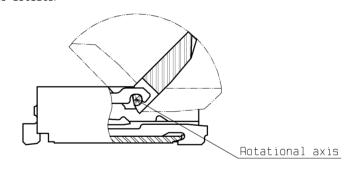


3. The actuator will not open more than 135°. Do not apply any force backward beyond this point. Otherwise, the actuator may come off or break.

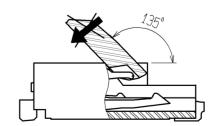


	DRAWING NO.	ΕD	C3-157791-06		
H 25	PART NO.	FH26	W-51S-0.3SHW(05)	
	CODE NO.	CL580)-2415-6-05	\triangle	4/
	7		Ω		

FORM HC0011-5-8 1

孙 図

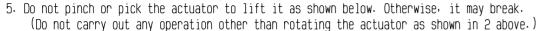

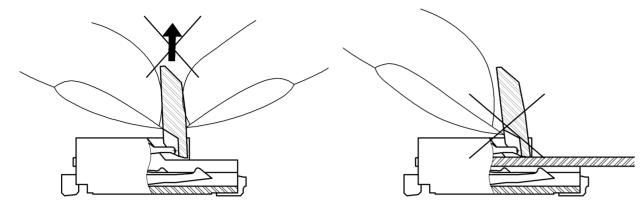

♦Direction of Contacts

This connector has contacts on the bottom. Thus, insert the FPC with the exposed conductors face down.

♦Inserting the FPC

1. Insert the FPC horizontally along the surface and at a right angle to the connector.

Insert it properly to the very end.

If the FPC is inserted at a slant (incorrectly),

the conductors may short-circuit due to pitch shift or the edge of the FPC may catch in the terminals. resulting in deformation of the terminals.


This connector has a ZIF structure, and its effective engagement length is 0.35 mm (when the recommended FPC nominal is used).

Use the actuator carefully to prevent the FPC from dislocating after inserting it.

2. Do not insert the FPC diagonally from above. If the FPC is inserted at a slant (incorrectly) as shown below in the FPC insertion process. the FPC may bend and patterns may break or the FPC may not insert completely. resulting in improper conduction.

*Keep a sufficient FPC insertion space in the stage of the layout in order to avoid incorrect FPC insertion. Besides, it is not difficult to insert FPC correctly all the way to the end. Design the proper layout of parts.

XMake adjustments with the FPC manufacturer for FPC bending perfomance and wire breakage.

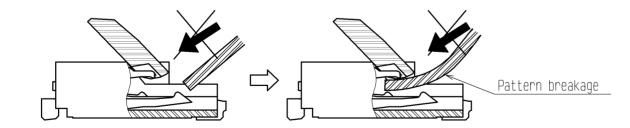


◆Checking the Locking Condition

In the locked condition, make sure that the actuator is horizontal on the board surface. Do not apply excessive force to it near the 0° position of the actuator. Otherwise, the terminals may be deformed. (Allowable force: 1 N or less)

[INSTRUCTIONS ON FPC LAYOUT AFTER CONNECTION]


♦Load to FPC

Be very careful not to apply any force to the FPC after inserting it. Otherwise, the connector may become unlocked or the FPC may break. Fix the FPC in particular, when loads are applied to it continuously. Design the FPC layout with care not to bend it sharply near the insertion opening.

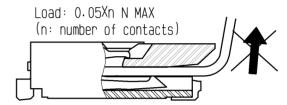

INSTRUCTIONS ON REMOVING FPC!

♦Release the actuator to remove the FPC.

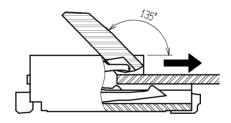

♦Instructions on Manual Soldering

Follow the instructions shown below when soldering the connector manually during repair work, etc.

- 1. Do not perform reflow soldering or manual soldering with the FPC inserted into the connector.
- 2. Do not heat the connector excessively. Be very careful not to let the soldering iron contact any parts other than connector leads. Otherwise, the connector may be deformed or melt.
- 3. Do not use excessive solder (or flux).

If excessive solder (or flux) is used on the terminals, solder or flux may adhere to the contacts or rotating parts of the actuator, resulting in poor contact or a rotation failure of the actuator.

Supplying excessive solder to the reinforcing bracket may hinder actuator rotation. resulting in breakage of the connector.

Γ		DRAWING NO.	EDC3-157791-06		
l	HZ5	PART NO.	FH26W-51S-0.3SHW(35)	
		CODE NO.	CL580-2415-6-05	\triangle	5/5
		7	Ω		