
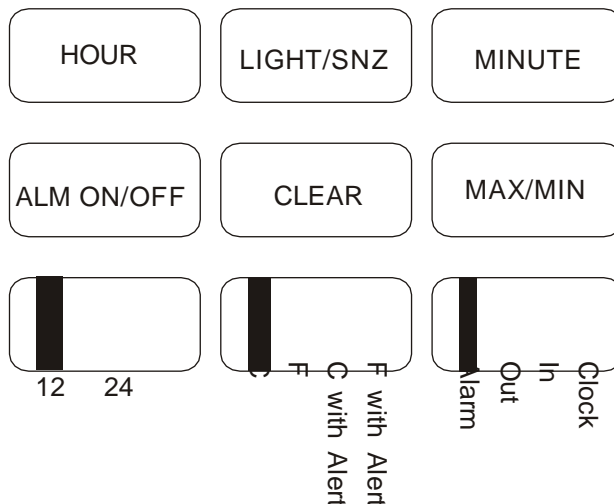


# JHW-710

## 一) 功能特性


- 1) 工作電壓1 . 5 V, 超低電源功耗.
- 2) 基本時間顯示, 可選擇12 / 24制式轉換.
- 3) 有鬧鐘功能和貪睡功能.
- 4) 有3秒LED照明.
- 5) 室內溫度測量範圍:- 15 ~ + 70 deg C ( 5 ~ 158 deg F)  
室外溫度測量範圍:- 50 ~ + 70 deg C (- 58 ~ 158 deg F)  
溫度顯示精度: 0 . 1 deg  
C. 溫度精確度: 1 deg C.
- 6) 開機時可選擇華氏或攝氏, 和霜點警報.
- 7) 可查看最高最低溫度記錄.

## 二) 液晶顯示圖案(含按鍵圖)

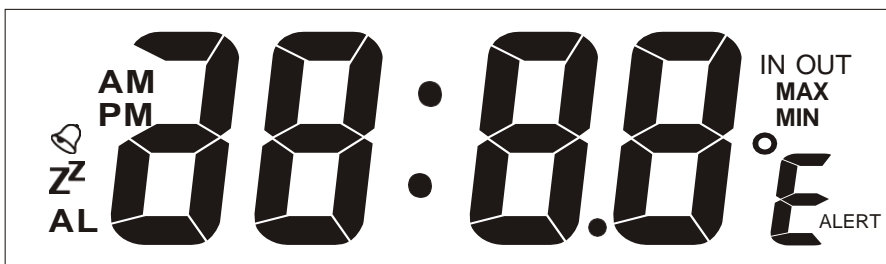


# JHW-710

## 三) 流程圖

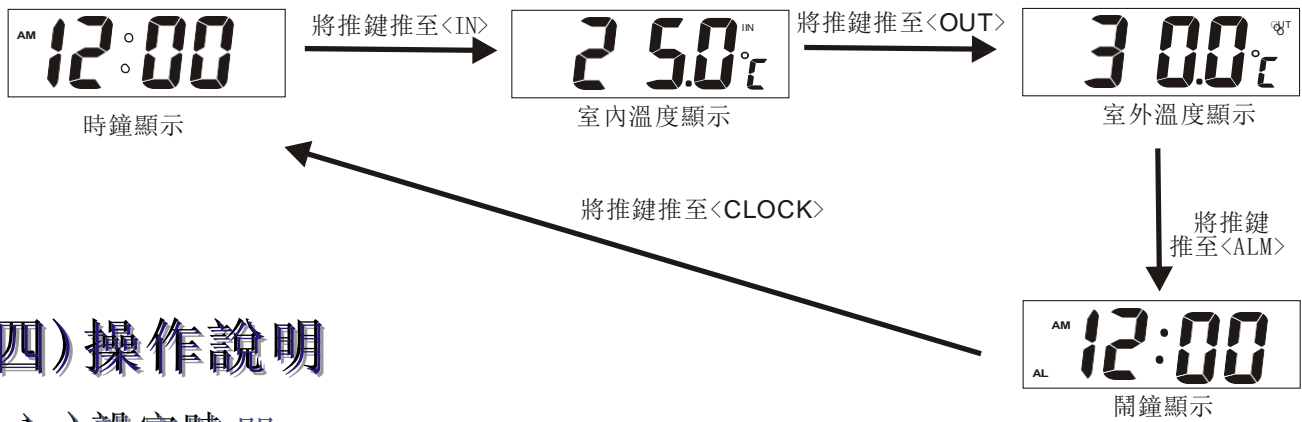


## 四) 操作說明

### 1) 設定時間

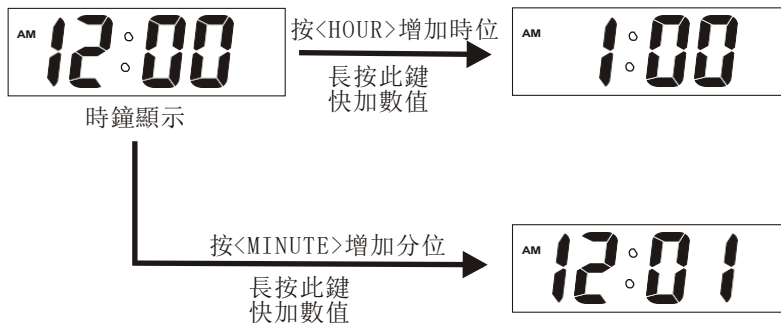


### 2) 查看室內最高最低溫度記錄

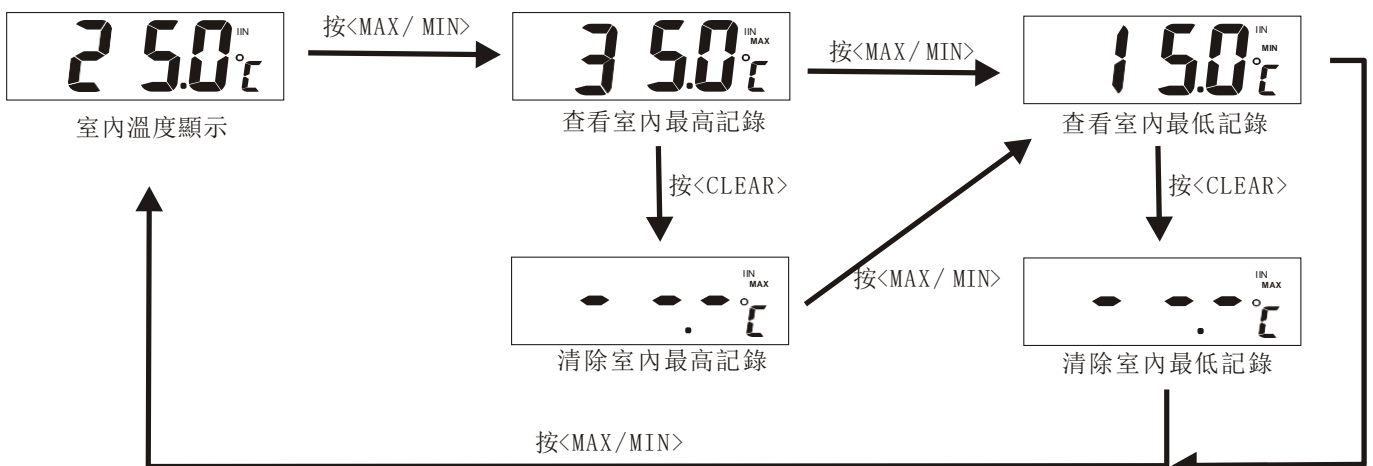

註：  
當溫度達到-1~3.9度，霜點警報正式啟動，  
每分鐘響一次，每次響5秒。

# JHW-710

## 3) 查看室外最高最低溫度記錄

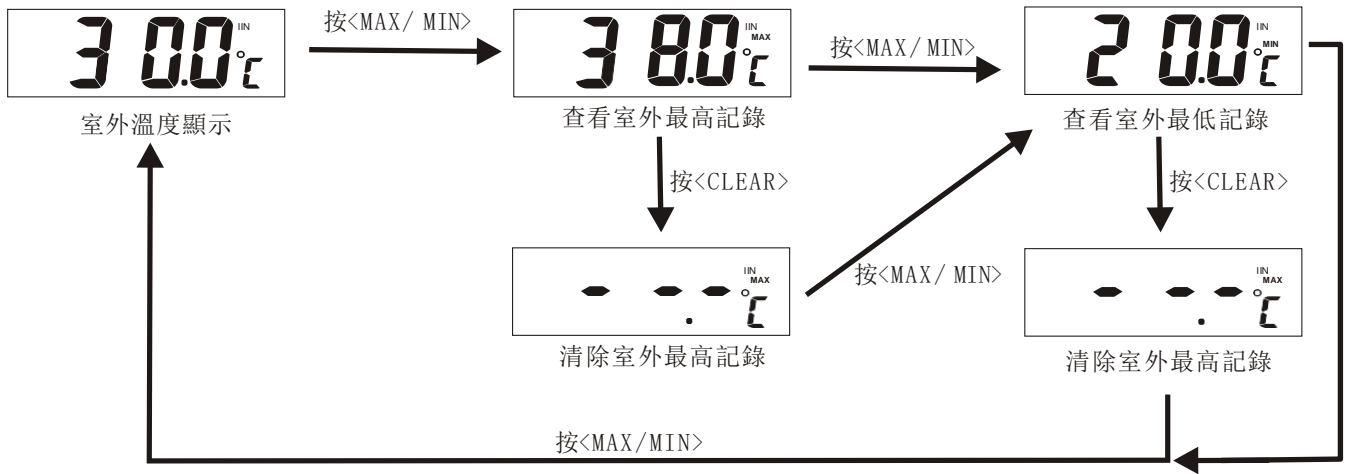


## 4) 鬧鐘設定



# JHW-710

---

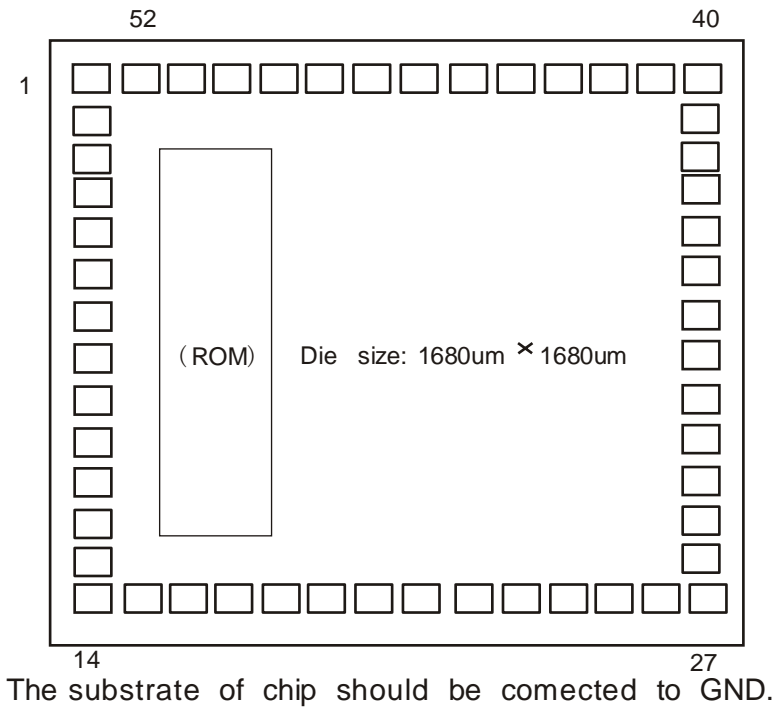

# JHW-710

NO	NAME	X	Y	NO	NAME	X	Y
1	N.C.	77.5	1602.5	27	N.C.	1602.5	77.5
2	XIN	77.5	1472.5	28	N.C.	1602.5	207.5
3	XOUT	77.5	1357.5	29	N.C.	1602.5	322.5
4	GND	77.5	1242.5	30	N.C.	1602.5	437.5
5	VDD1	77.5	1127.5	31	N.C.	1602.5	552.5
6	VDD2	77.5	1012.5	32	N.C.	1602.5	667.5
7	VDD3	77.5	897.5	33	SEG19	1602.5	782.5
8	CUP1	77.5	782.5	34	LIGHT	1602.5	897.5
9	CUP2	77.5	667.5	35	KOUT1	1602.5	1012.5
10	COM1	77.5	552.5	36	KOUT2	1602.5	1127.5
11	COM2	77.5	437.5	37	KOUT3	1602.5	1242.5
12	COM3	77.5	322.5	38	IOA1	1602.5	1357.5
13	COM4	77.5	207.5	39	IOA2	1602.5	1472.5
14	COM5	77.5	77.5	40	N.C.	1602.5	1602.5
15	SEG1	207.5	77.5	41	N.C.	1472.5	1602.5
16	SEG2	322.5	77.5	42	IOB1	1372.5	1602.5
17	SEG3	437.5	77.5	43	IOB2	1242.5	1602.5
18	SEG4	552.5	77.5	44	IOB3	1127.5	1602.5
19	SEG5	667.5	77.5	45	BZ	1012.5	1602.5
20	SEG6	782.5	77.5	46	IOC1	897.5	1602.5
21	SEG7	897.5	77.5	47	IOC2	782.5	1602.5
22	SEG8	1012.5	77.5	48	IOC3	667.5	1602.5
23	N.C.	1127.5	77.5	49	IOC4	552.5	1602.5
24	N.C.	1242.5	77.5	50	RESET	437.5	1602.5
25	N.C.	1357.5	77.5	51	INT	322.5	1602.5
26	N.C.	1472.5	77.5	52	N.C.	207.5	1602.5